

THIS PRODUCT
HAS NOT COMPLETED
VALIDATION/QUALIFICATION
TESTING CONTACT TIP LOCATION SHOWN PRIOR TO ACTUATION SOCKET VIEWS DEPOPULATED FOR CLARITY EUTECTIC SOLDER BALLS, 635n37Pb WATERIAL: HOUSING: LCP UL94V-0, CONTACT: COPPER ALLOY PRODUCT NUMBER WILL BE ASSIGNED WHEN RELEASED Transaction of the second DESIGN IS SUBJECT TO CHANGE WITHOUT NOTICE PROPOSED DESIGN CTF DIMENSION WALL TANK THE REPORT OF THE PARTY OF THE 13131 1.092 TYP 0.0  $\triangleleft$  $\triangleleft$ 4 0 CONFIDENTIAL -0.10 MIN A BEFORE SOLDER BALL REFLOW - 16.5 SECTION ILLUSTRATES HOUSING IN FINAL SEATING POSITION IN FRAME AFTER NOMINAL SOLDER BALL REFLOW SOLDER BALL SHOWN BEFORE REFLOW SCALE 12:1 1.27 2.43 3.00₺ A 10.2 SECTION E-E 5.60 △0.33 AFTER FRAME --ACTUATION TO
MOTHERBOARD AFTER
REFLOW A 0.2 ABC-44.8±0.2 6 **△** (Φ (Θ) | (Θ) | CONTACT TIP POSITION AFTER DEFLECTION -SEE DETAIL -C-- 0.2 AB 14.60±0.05 合 G 0.23 (F) -SEE DETAIL 12.13 3.00 DETAIL G SCALE 30:1 0.0 9 1489825-1 AS SHOWN IN PRE-SEATED POSITION 37.25 2 PLC OF CONTACT POINT -15.00±0.05 (\$\overline{0}\$ \text{ A | 0 \overline{0}\$ \o į 41 △ 37.60±0.05-10 1.27 TYP 44.8±0.2 (\$\phi \text{\tin}\xint{\text{\tett{\text{\tetx{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\texi}\text{\text{\text{\texi}\text{\text{\texi}\text{\text{\text{\texi}\text{\text{\text{\text{\teti}\text{\text{\texi}\text{\text{\text{\text{\text{\text{\text{\t † **⊲** -8-DETAIL F SCALE 10:1 LGA735 0 0 **CONTRACT** 1.092 17P OF CONTACT POINT 37.25 2 PLC 9

37.60€

٥

U


 $\equiv$ oriented Contact

⋖

•

Sama



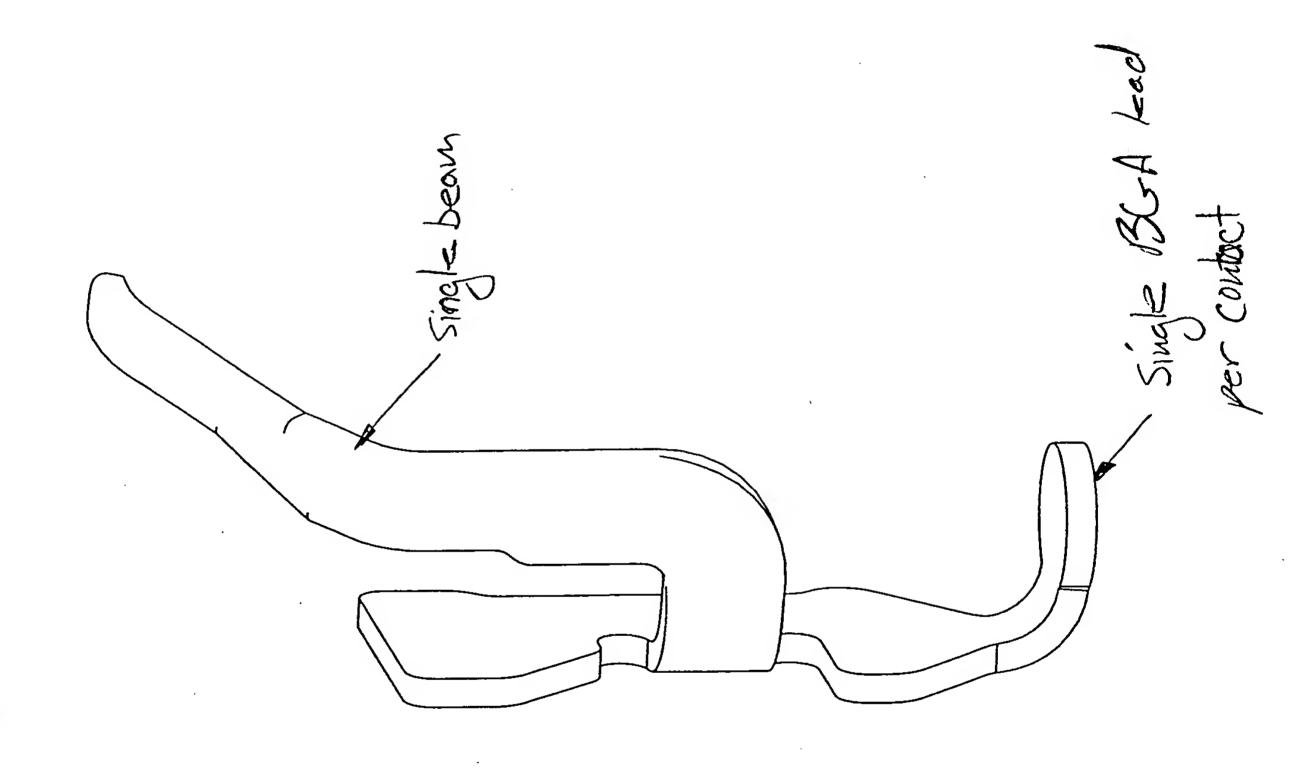

" Prior Art